Please make sure that **eToken is not plugged** into the usb port until the installation program requests that.

If at any time Windows tries to install drivers using Plug and Play cancel the Found New Hardware wizard.

# You MUST install the C-Map Chart Database first, then install the C-Map chart licence.

# And install charts through ECPINS menu also.

There are 4 processes to install C-Map chart and licence:

#### 1. Install C-Map Utilities

Insert ECPINS Software CD into the drive. Terminate the ECPINS installation process. Open a Windows Explorer. Select CDROM drive. Select folder Utilities > C-Map Double click InstallCMAP.exe The following dialog will pop up: Install C-MAP Select the Type of C-MAP License Software License Etoken

Select Etoken.

Browse For Folder
Select Target Folder
<ul> <li>Desktop</li> <li>Desktop</li> <li>My Documents</li> <li>My Computer</li> <li>My Network Places</li> <li>Recycle Bin</li> <li>other shortcuts</li> </ul>
Make New Folder OK Cancel

To create C:\C-Map\_Utilities folder click on C: drive (under My Computer) and then select Make New Folder. Enter folder name 'C-MAP\_Utilities'.

Select C:\C-MAP\_Utilities as the target directory.

Browse For Folder	? ×
Select Target Folder	
Dealthan	
Desktop	-
Encal Disk (C:)	
C-Map_Utilities	
Documents and Settings	
🕀 💼 drivers	
OSI_util	
🕀 🖳 Program Files	
RECYCLER	
System Volume Information	
	-
OK Cancel <u>N</u> ew Fo	lder

Click **OK** to continue the installation process.

Windows prompts to insert the Etoken.

eTInstall		X
If you have an eToken please If you do not have an eToken		
<u>Y</u> es	No	

Insert Etoken and select Yes.

Depending on your system configuration (if you had installed C-MAP Utility program in past) you may see following dialog:

eTInstall	X
Setup has detected that you use a new eToken.you need to reinitialise your C-MAP User and obtain new licenses from C-MAP. If this is the case YES to the question below. If you want to keep your previous state you should choose NO to the question below:	e please choose
Do you want to reinitialise?	
<u>Y</u> es <u>N</u> o	

#### Select Yes.

Again, depending of your system configuration the new dialog might appear:

eTInstall		×
Are you sure? You lose all lic	enses obtained:	from C-MAP.
( <u>Y</u> es	No	

Select Yes.

Confirmation dialog shows that installation completed successfully.

Email the Etoken number to C-Map to obtain your user licence file (password.usr).

#### 2. Install Chart database

Start ECPINS.

Insert the Chart Database CD into the drive

Using Windows Explorer create a folder for storing C-Map database (e.g. D:\C-Map\_Charts)

Goto ECPINS Main Menu > Chart Selection > Licenses > C-Map > Database Administrator

🧃 CM-93/3 Database Admini	strator	×
Default Registered DB	Available Database —	
	Register Database	
	Copy Database to HD	
	Set as default	Dongle on 'Curly'
Check Signature	Unregister Database	Check Signature

#### Click Copy Database to HD.

Select **D**:

Click the + sign beside D: to expand the folders

Select C-Map Database folder you have created above (C-Map\_Charts)

The following dialog will pop up:

Copy	X
	The D:\CMAPprofessional+\Professional+\CM93_3 folder does not exist. Do you want to create it?
	Yes No

Select Yes when prompt to create the new folder.

This will copy the database from the CD to the hard drive. Once it has finished copying, a pop up is displayed saying that the database has been successfully copied and registered.

This process applies to Professional (World), ENC or Professional+ charts.

🧃 CM-93/3 Database Admini	strator	×
Default     Registered DB       ■     ENC (67)       ✔     World (184)	Available Database —	
	Register Database	
	Copy Database to HD	⊕
	Set as default	Dongle on 'Curly'
Check Signature	Unregister Database	Check Signature

The last installed database is automatically registered. If you are installing licenses for some other database you will have to set it as default. This can be done by selecting the database and then pressing the Set as Default button. A green check mark will appear next to the defaulted database.

Click on button 'X' in top right hand side corner to close the Database Administrator window.

### 3. Install Chart Licence

To install chart licenses that you have received from C-Map (password.usr):

Goto ECPINS Main Menu > Chart Selection > Licenses > C-Map > License Administrator

🖁 LicenseAdm		×
System ID: Offshore Systems Ltd. 21	🔽 Subscription	
Add License menually	Save Order	Display Order
Add License manually	Zone 6, Area 23 🔺	Zone 6, Area 4
Get expired licenses	– Zone 6, Area 24 – Zone 6, Area 25	
	Zone 6, Area 3	
Licenses list	Zone 6, Area 4	
	Zone 6, Area 5 Zone 6, Area 6	
Add Licenses from file	Zone 6, Area 7	
	Zone 6 Area 8	Clear
License order		05-2006
	Add dataset	Add expired at

Insert floppy that contains the Licence file from C-Map or copy the licence file to the ECPINS computer hard drive.

Click Add Licenses from file.

Select file **password.usr** from the floppy disk or hard drive.

🖁 LicenseAdm	X
My Computer     My Computer	password.usr
⊡ Local Disk (C:) ⊡ Local Disk (D:) ⊡ Atonis	
E Ender E	
⊕ <mark>⊕</mark> eng5051 ⊕ <u>⊖</u> eng5053	
i in the info in the info info info info info info info info	
ΟK	Cancel

Click OK.

Click Yes to proceed.

Click **Close** to complete the installation of licence.

Click on 'X' button in top right hand corner of the License Administrator window to close it.

## 4. Install Charts through ECPINS Menu

Install Charts		
Type of Charts: CHAP T	Select Target Folder	Create New
e:\data_5_1_new\CHA Up	Select Charts	
[] [ENC] [Professional+] [World]		
Search For Charts	Select Visible	Select All
	Install Gharts	Exit

Goto ECPINS Main Menu > Chart Selection > Chart Install > Install Charts

Select C-Map at Type of Charts

Different types of C-MAP Charts will be displayed, ENC, World or Professional +

Pick the relevant chart type (World, Professional + or ENC; depends on what you have purchased from C-Map)

Select the relevant region or zone charts from the list.

Install Charts	
Type of Charts: CMAP Select Source Folder d:\eng5051\data\CMA f] Arctic coast of Euro Coast of Western and Coasts of China, Kor Indonesia, Australia Mediterranean Sea - North & Central Amer Northern Europe - Zo South American Coast Search For Bharts	Select Target Folder            • Create New          Select Charts         AREA 1 - SOUTHERN CHINA INCLUDING HONG KONG         AREA 2 - NORTHERN CHINA AND NORTHERN JAPAN         AREA 3 - CENTRAL CHINA, S. KOREA, N. KOREA, TAIWAN         AREA 4 - CENTRAL & S. CHINA, CENTRAL & S. JAPAN         AREA 5 - SPECIAL         AREA 6 - SPECIAL         AREA 7 - SPECIAL         AREA 8 - SPECIAL         AREA 9 - SPECIAL         Select Visible         Select All
	Install Gharts Exit

MUST select C-Map (for all zones or type of chart) in Select Target Folder. Note: This is not the same

folder as the one you used for the database)

Select area of interest or Select All to install the charts.

Click Install Charts.

CH	art Installation Completed
	INSTALLED: AREA 2 - NORTHERN CHINA AND NORTHERN JAPAN
	OK
Install Charts	
Type of	
Charts: CMAP	zone6_area2  Create New
Select Source Folder d:\eng5051\data\CMA Up	
[++]	AREA 1 - SOUTHERN CHINA INCLUDING HONG KONG
	AREA 3 - CENTRAL CHINA, S. KOREA, N. KOREA, TAIWAN AREA 4 - CENTRAL & S. CHINA, CENTRAL & S. JAPAN
	AREA 5 - SPECIAL AREA 6 - SPECIAL AREA 7 - SPECIAL
	AREA 8 - SPECIAL AREA 9 - SPECIAL
	AREA 10 - SPECIAL
Search For Charts	Select Visible Select All
	Install Charts Exit

Click **OK** to Chart Installation Completed pop up.

Installation of Charts completed.